

## WALTON Primo ICS Upgrading

	Version	Note
Driver	Adb_driver	AP driver
	HK11-VB717-27	BP driver
Tool	Primo Download	BP Download Tool (1st part)
	Primo Flash Tool	AP Download Tool (1st part)
Software	Primo ICS Software_BP part	Update with BP Tool
	Primo ICS Software_AP part	Update with AP Tool


### Driver installation

#### 1) Install AP part driver

Power off handset, press “Power key + Voice Up key” until the screen shows green, plug in usb cable, PC will remind you of installing new hardware. Unzip “ Driver”, select adb driver file, install AP driver.

**Path:** Right click on My computer>Manage>Device manager>Android(Yellow notification)>Update driver software>browse path> select **adb** folder >Continue anyway>finish

When you install AP driver successfully, you will find “Fastboot interface” in device manager. As below

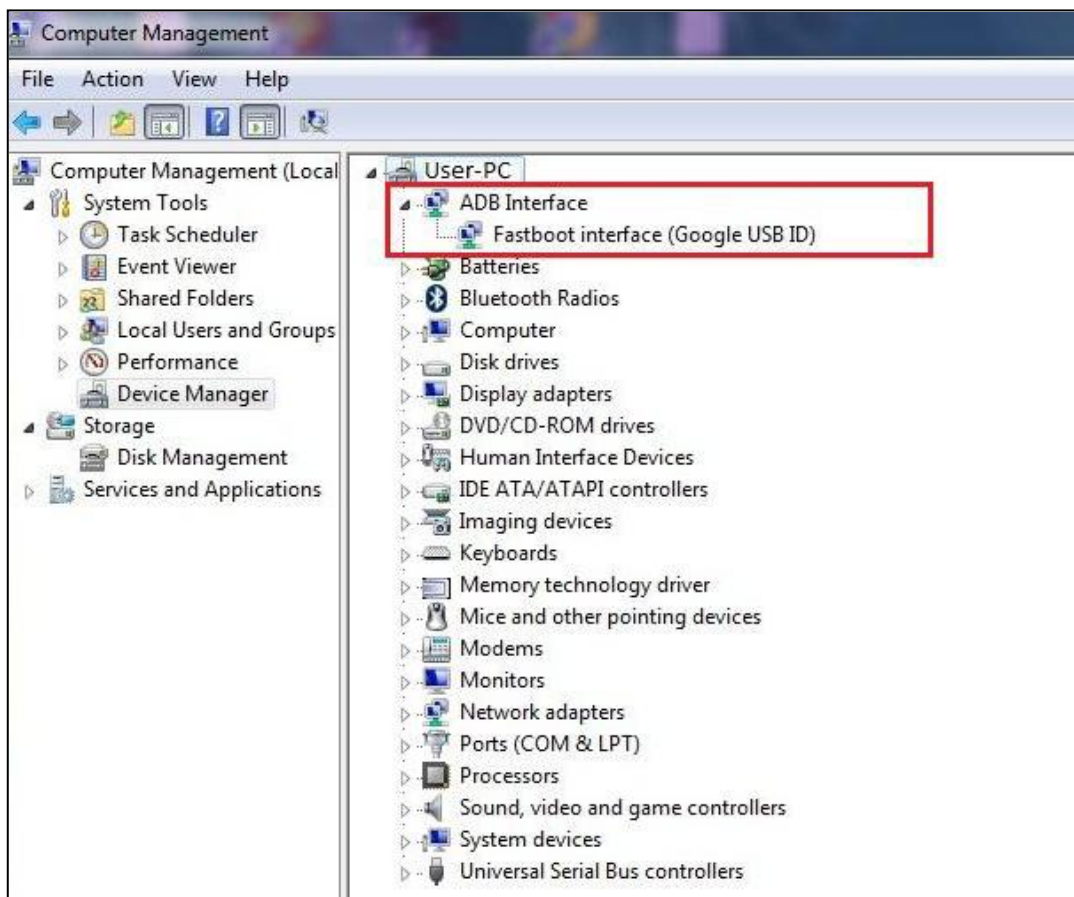


#### 2) Install BP part driver

(1) Power on handset, plug in 5Pin USB cable, Unzip “Driver”, select HK11-VB717-27\_1.0.56 driver file, install BP driver.


**Path:** Right click on My computer>Manage>Device manager>Tiyanyu HS-USB Driver (Yellow notification)>Update driver software>browse path> HK11-VB717-27\_1.0.56\Win32\x86\free >Continue anyway>finish.

When your BP driver is installed successfully, you will find one modem and two ports in device manager. As below:

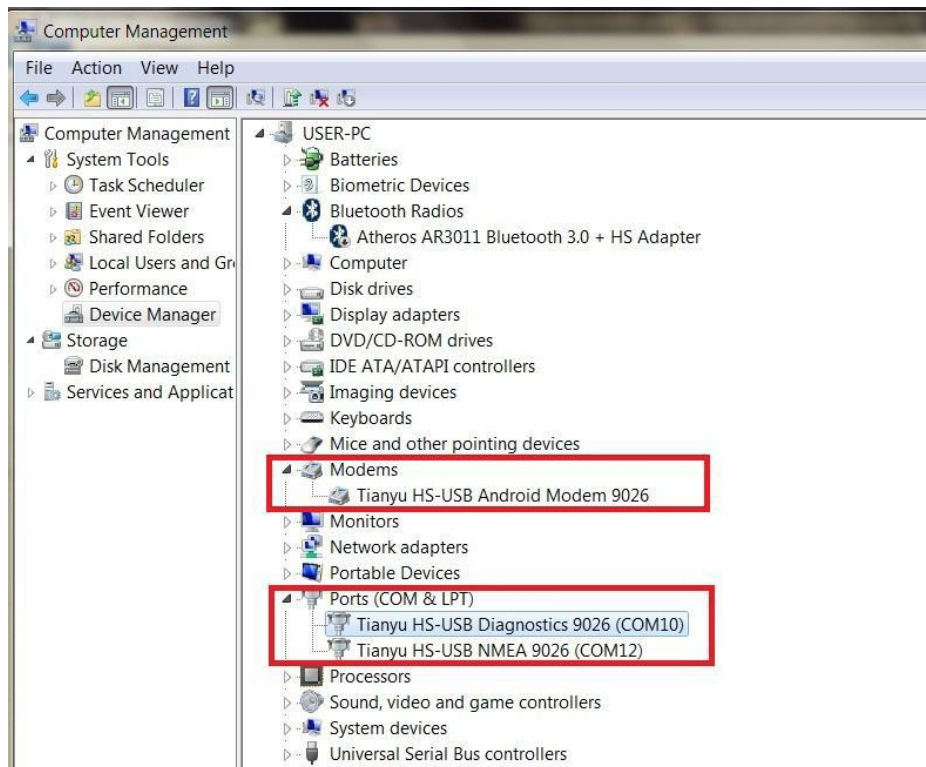

## **Download BP:**


Open **PrimoDownload** tool, set your handset into BP mode (Power key+ Voice down key) and connect your phone with USB cable.

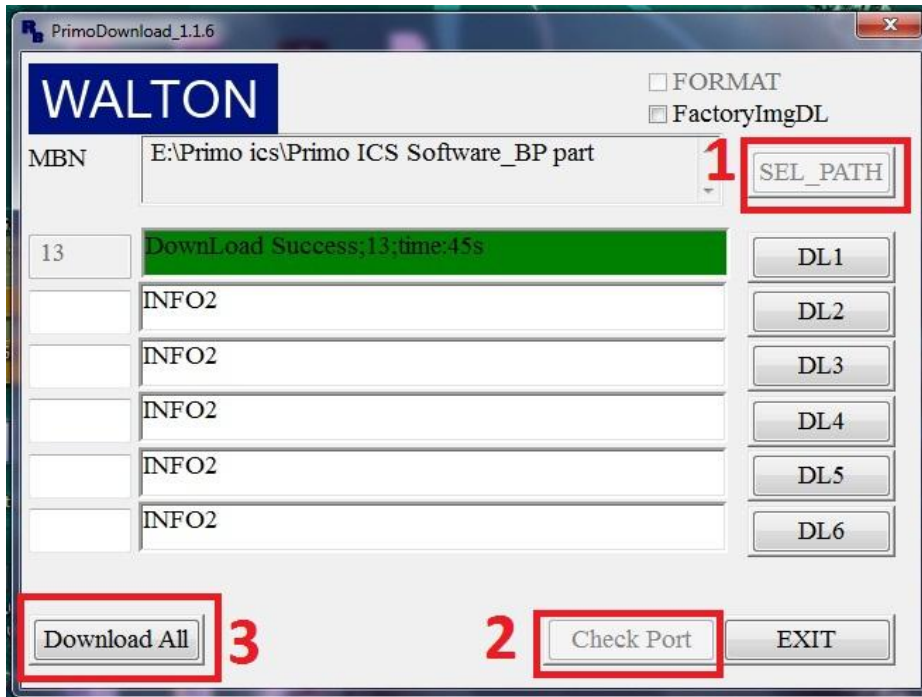

1. Click set path>Browse folder>Select **Primo ICS Software\_BP part**.
2. Click **Check Port**
3. Click **Download All**

### **AP Download:**

Open **PrimoFlash** tool, set your handset into AP mode (Power key+ Voice up key) and connect your phone with USB cable.

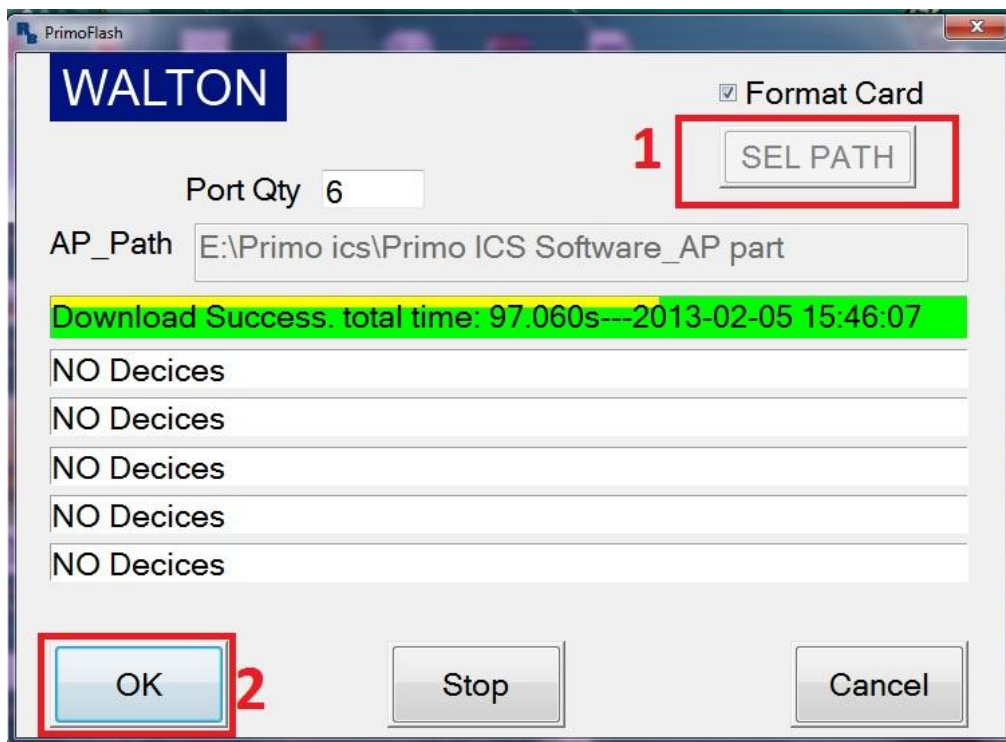

1. Click **Set path**>**Browse folder**>Select **Primo ICS Software\_AP** part.

2. Click **Ok** for Start download.

Note: If your antivirus detects Primo Flash Tool as virus, disable your antivirus till software is finish.